

Work Order ID 72418

Monday, July 25, 2011 1:15:48 PM



Page 1

Item ID: D212-664-201

Accept



Setup Start



Revision ID: U/R

Stop



Item Name: Crosstube Aft

Start Date: 7/25/2011 Start Qty: 1.00

Required Date: 8/11/2011 Req'd Qty: 1.00

Cust Item ID:

Customer:

Reference:

Approvals:

Process Plan:

Date: 11-05-27

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Run Start



Stop



Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

Draw Nbr

Revision Nbr

D212-664-241

Rev D U/R

DSI9563

A

2CN 11.614

100

0.00



DOCUMENT CONTROL

DC

Memo

0.00

Document Control

Photocopy bluefile and create labels as per PPP D212-664-201

CHG005

Sw 11/10/26

110

0.00



Pick Kit

Packaging

Packaging

Memo

0.00

Packaging

TW
MO

11-10-05

B72418 D212-664-201

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 72418

Monday, July 25, 2011 1:15:48 PM



Page 2

Item ID: D212-664-201

Accept



Setup Start



Revision ID: U/R

Item Name: Crosstube Aft

Stop



Start Date: 7/25/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 8/11/2011 Req'd Qty: 1.00

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120 CNC Bend 2 CNC Alpha 160 Bender	BENDING MACHINE - CROSSTUBES Memo Bend tube as per Dwg D212-664-241 using CNC bender program 212- aft	0.00 0.00							
				JW MO				11-10-05	
130 QC Quality Control	QC15- Crosstube Dimensional Check Memo	0.00 0.00							
				Smolke					

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 72418

Monday, July 25, 2011 1:15:48 PM



Page 3

Item ID: D212-664-201

Accept



Setup Start



Revision ID: U/R

Item Name: Crosstube Aft

Stop



Start Date: 7/25/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 8/11/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start



Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140	Crosstubes	0.00							
	Crosstubes								
Crosstubes	Memo 1-Drill pilot holes in tube as per Dwg D212-664-241 using drill Jig DT8550, DT8551, drill table DT8577 and locate tower holes #8 as per QSI0010. 2-Ream hole to finish size in tube as per Dwg D212-664-241 using drill Jig DT8550 & DT8551. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes. 3-Scribe part # and batch # using vibrating stylus as per Dwg D212-664-241 4-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D212-664-241	0.00							
150	Crosstubes Chemical Conversion	0.00							
	HandFXtube								
Hand Finishing Crosstubes	Memo Chemical Conversion Coat as within 24 hours of bending and drilling	0.00							

BT
11-10-06

TW 11-10-07

TW 11-10-07

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 72418

Monday, July 25, 2011 1:15:48 PM



Page 4

Item ID: D212-664-201

Accept



Setup Start



Revision ID: U/R

Stop



Item Name: Crosstube Aft

Start Date: 7/25/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 8/11/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

160

QC3- Inspect Part Finish

0.00

Sulco/11



QC

Memo

0.00

Quality Control

170

QC5- Inspect part completeness to step on W/O

0.00

Sulco/11



QC

Memo

0.00

Quality Control

180

Outsource process - NDT per QSI038 4.1

0.00



Outsource2

Memo

0.00

Outsource process - NDT

Liquid Penetrant Inspection as per QSI 038
Issue P/O: *15157*
LPI as per ASTM 1417 Level 2
Attach copy of NDT results to work order

11-10-14

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 72418

Monday, July 25, 2011 1:15:48 PM



Page 5

Item ID: D212-664-201

Accept



Setup Start



Revision ID: U/R

Stop



Item Name: Crosstube Aft

Start Date: 7/25/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 8/11/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

190

Receive & Inspect for Damage & Mat'l Certs

0.00



Packaging

Packaging

Memo

0.00

Packaging

Ensure copy of NDT results attached to work order.

Revised 11/17/11

200

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

Quality Control

Inspect for damage & ensure results are as per Dwg D212-664-241

11 10 17

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 72418

Monday, July 25, 2011 1:15:48 PM



Page 6

Item ID: D212-664-201

Accept



Setup Start



Revision ID: U/R

Item Name: Crosstube Aft

Stop



Start Date: 7/25/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 8/11/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start



Stop



Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

210

Spray Painting per QSI005 4.2

0.00



SprayPaint

SprayPaint

Memo

0.00

Spray Painting

1-Prime inside and outside crosstube as per QSI 005 4.2

2-Paint outside crosstube as per DEO D212-667-241 with White Imron as per QSI 005 4.2

PRIME:

Start Time: 3:00

Finish Time: 4:00

7/11/10/17 ①

PAINT:

Start Time: 9:30

Finish Time: 11:00

7/11/10/18 ①

11 / 10 / 18 ①

220

QC14- Inspect Spray Paint

0.00



QC

Memo

0.00

Quality Control

Then, Wrap in plastic bag to protect from scratches

11 - 10 - 19

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 72418

Monday, July 25, 2011 1:15:48 PM



Page 7

Item ID: D212-664-201

Accept



Setup Start



Revision ID: U/R

Stop



Item Name: Crosstube Aft

Start Date: 7/25/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 8/11/2011 Req'd Qty: 1.00

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start



Stop



Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

230

0.00



Crosstubes

0.00

Crosstubes

Memo

1-Abrade mating surfaces of support and crosstube with 400 grit sandpaper, clean the area with 41058 wash 'n' wipe

2-Install supports with Proseal 890 per DSI9563 and QSI 015
A/R Proseal 890 Batch: 118234

3-Install clamps as per Dwg D212-664-241. Torque clamps to 80-100 in lb. > 11/10/21 ①

W 11 10 20 ①

240

QC5- Inspect part completeness to step on W/O

0.00



0.00

QC

Memo

8 11/10/26

Quality Control

④

250

Pick Kit

0.00



0.00

Packaging

Memo

8 11-10-26

Packaging

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 72418

Monday, July 25, 2011 1:15:48 PM



Page 8

Item ID: D212-664-201

Accept



Setup Start



Revision ID: U/R

Stop



Item Name: Crosstube Aft

Start Date: 7/25/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 8/11/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start



Stop



Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

260

QC4- 100% Inspect kits for completeness

0.00



QC

Memo

0.00

Quality Control

8/11/26

270

Packaging

0.00



Packaging

Memo

0.00

Packaging

Identify and pack for shipping as per PPP D212-664-201

Rec H

11/10/26 SP

280

QC21- Final Inspection - Work Order Release

0.00



QC

Memo

0.00

Quality Control

11/10/28 SP

MF 11-10-27

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Monday, July 25, 2011 1:16:00 PM

Page 1

Work Order ID: 72418

Parent Item: D212-664-201

Parent Item Name: Crosstube Aft



Start Date: 7/25/2011

Required Date: 8/11/2011

Start Qty: 1.00

Required Qty: 1.00

Comments:

IPP Rev:E 04.02.16 Reformat K/DS
 IPP Rev:F 06-03-29 Remove Coments on Pick List JLM
 IPP Rev:G 07-04-30 As per Rev C JLM
 IPP Rev:H 08-05-22 up date Qty of rubber cushion DD verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D212-664- 201TRNRevC		Manufactured	No	B 73643		110	Each	0.0000	1	1		11-10-05	
Crosstube Turning Detail													
D3595-063-530		Manufactured	No			230	Each	70.0000	2	2		11-10-20	
RUBBER CUSHION													

Location

Loc Qty

Loc Code

LG

56

70067

56

LG055

14

63407

6

67185

8

D2940-1

Manufactured

No

230

Each

15.0000

2

2



Support

B# 71308

Location

Loc Qty

Loc Code

LG

15

70737

15

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Monday, July 25, 2011 1:16:00 PM

Page 2

Work Order ID: 72418

Parent Item: D212-664-201

Parent Item Name: Crosstube Aft

Start Date: 7/25/2011

Required Date: 8/11/2011

Start Qty: 1.00

Required Qty: 1.00

MS21920-28

Purchased No

230 Each

31.0000 4 4



Clamp(per MIL-DTL-8783C)



11-10-20

B# 118713

Location

Loc Qty

Loc Code

FG

5

105884

5

LG050

26

116839

2

117998

24

Manufactured No

250 Each

28.0000

D3428-1



Placard



Sp. 073498

Location

Loc Qty

Loc Code

ST053

28

68920

6

71168

10

72048

12

Purchased No

250 Each

382.0000

MS21042L6



Nut



Sp.

Location

Loc Qty

Loc Code

ST300

382

117677

200

118078

82

118384

100

Purchased No

250 Each

0.0000

AN960JD616

NAS1149D0663J



Washer



Sp 11-10-26

m118614

Monday, July 25, 2011 1:16:01 PM

Shop Packet Print

Page 2

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Monday, July 25, 2011 1:16:01 PM

Work Order ID: 72418

Parent Item: D212-664-201

Parent Item Name: Crosstube Aft

Start Date: 7/25/2011

Required Date: 8/11/2011

Start Qty: 1.00

Required Qty: 1.00

AN6-40A

Purchased No

250 Each

122.0000

4 4



Bolt

SP

Location

Loc Qty

Loc Code

ST340

72

117366

22

118422

50

ST343

50

117688

50

46

AN6-41A

Purchased No

250 Each

46.0000

2 2



Bolt

SP 11-10-26

Location

Loc Qty

Loc Code

ST344

46

117366

40

118191

6

2x

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD		Work Order:	72418
Description: Crosstube High Aft (205/212)		Part Number:	D212-664-201
Inspection Dwg: D212-664-241 Rev: D		Page 1 of 1	

Required Dimension	Min	Max
Height	24.17	24.43
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.70

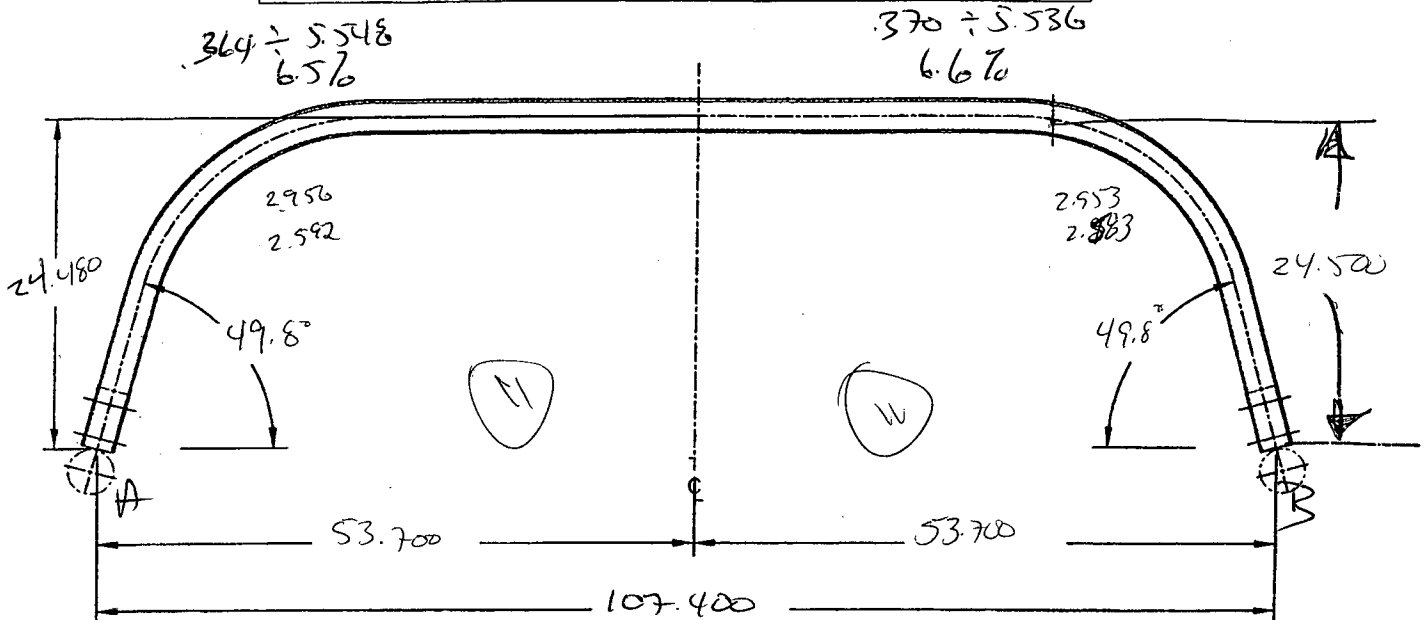

Comments
Side A = 6.576 crush (C) 1 Passes
Side B = 6.676 crush (C) 1 Passes
Bent high. Crushing high. Acceptable CP 11.10.06 (PS) 042

QC15 Inspection	8
Date	11/10/06

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	07.05.08	Dimensions updated per Dwg rev. C	KJ/JLM	
C	10.04.01	Dwg Rev updated	KJ	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

D212-664-241 72418 ECN 11-614

Item	Qty -241	Qty -241B	Part Number	Description
1	X		D212-664-241	CROSSTUBE ASSEMBLY (205/212 HIGH AFT)
2		X	D212-664-241B	CROSSTUBE ASSEMBLY (214 HIGH AFT)
3	1	1	D6006-129	CROSSTUBE
4	2	2	D2940-1	SUPPORT
5	4	4	D3595-063-530	RUBBER CUSHION
6	4	4	MS21920-28	CLAMP (OR MS21920-30)
7	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:


- MATERIAL: MANUFACTURED FROM D6006-129
FINISHED LENGTH = 124.362±0.020
- FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUFF
USING VIBRATING STYLUS.
- WEIGHT: D212-664-241 = 44.2 lbs (PER IIN-D212-664)
D212-664-241B = 44.2 lbs (PER IIN-D212-664)
- PART IS SYMMETRIC ABOUT CENTERLINE.
- RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- BEND PROGRESSIVELY WITH A MINIMUM OF 5 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- INSTALL D2940-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2940-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- INSTALL MS21920-28 CLAMPS (OR -30) WITH D3595-063-530 RUBBER CUSHIONS TO SECURE THE D2940-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.


ECN # 11-614
11.08.25
UNDER REVIEW
11.08.13

DEO ATTACHED

RELEASED
2009 -10-29
WY

D	REFORMAT/REVISE GENERAL NOTES/PART LIST; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; ADD -241B (ZN D4-2, B4-2); REMOVED REF & ADD TOLERANCES (ZN D8-3 & C4-3, C6-3 & A8-3); RELOCATED FLAG #6 PER PAR 08-046 (ZN A5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4	RF	09.09.30
C	REMOVE -1009 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS	PH	07.03.08
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	00.12.12
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	PH	DRAWING NO.	REV. D
MFG. APPR.	PH	D212-664-241	SHEET 1 OF 4
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT IT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

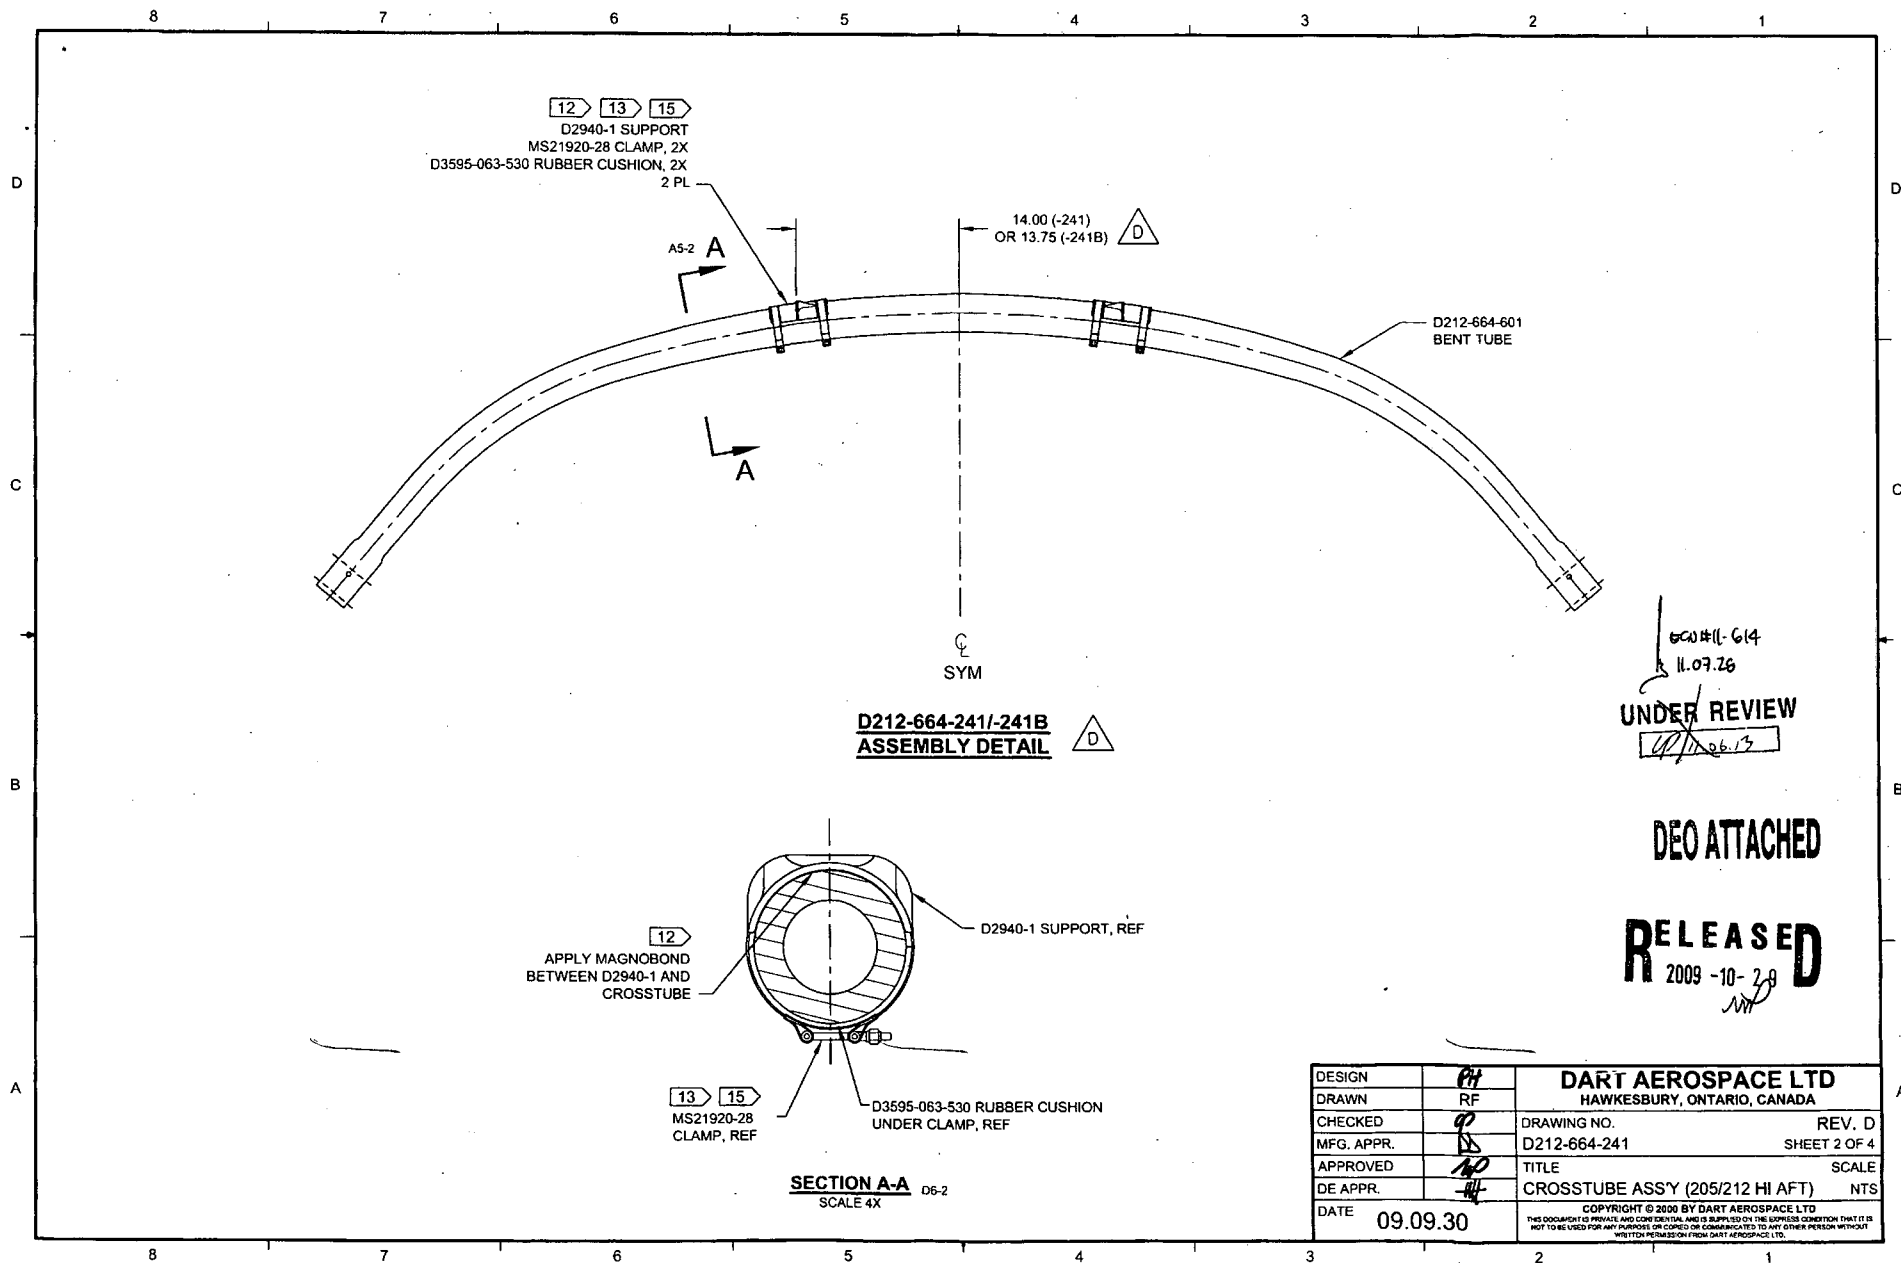

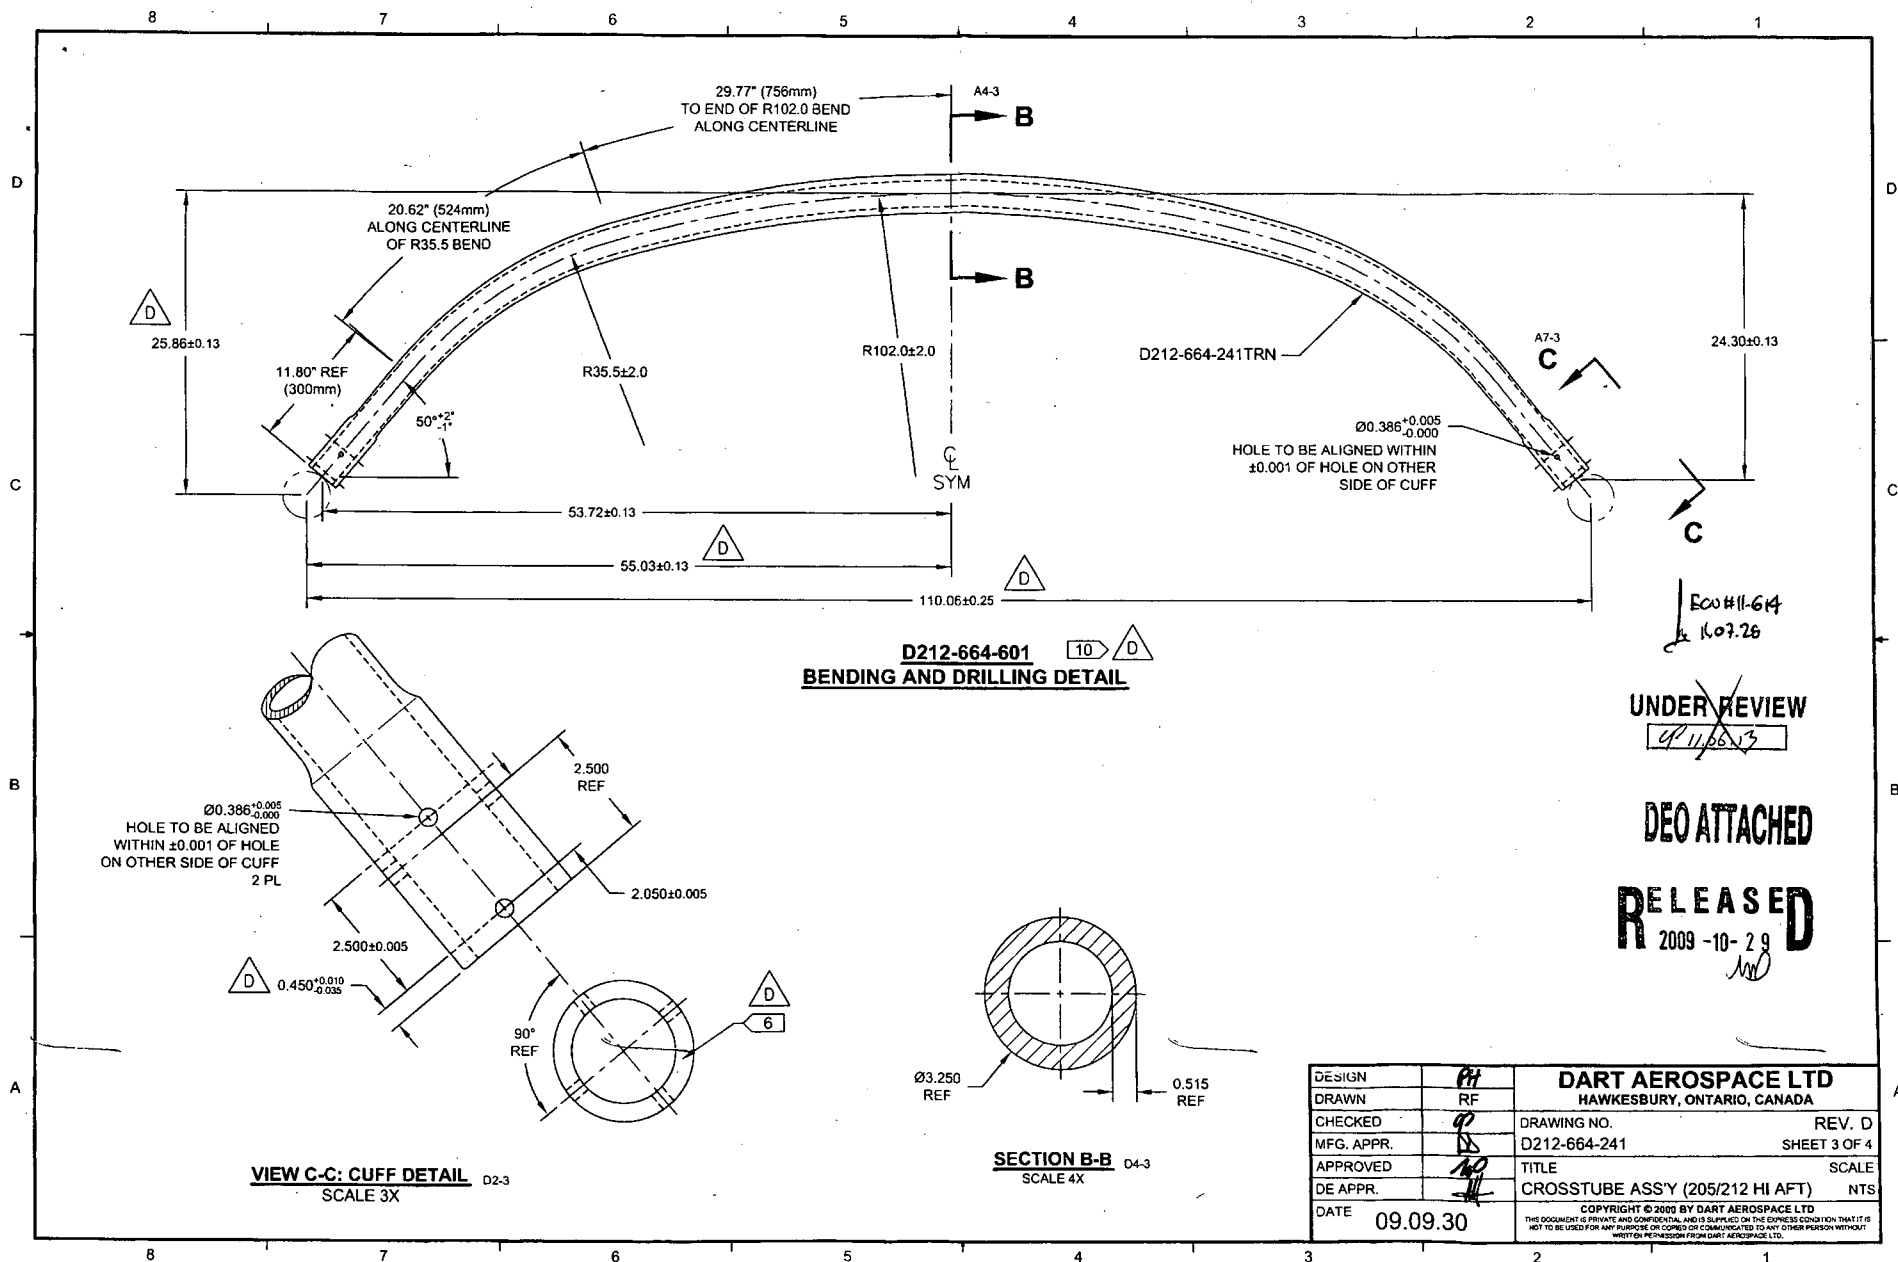


R100.0 TRANSITION
BETWEEN TAPERED
SECTIONS

R100.0 TRANSITION
BETWEEN TAPERED
SECTIONS


0.515 WALL
STOCK, REF

SEE DETAIL D

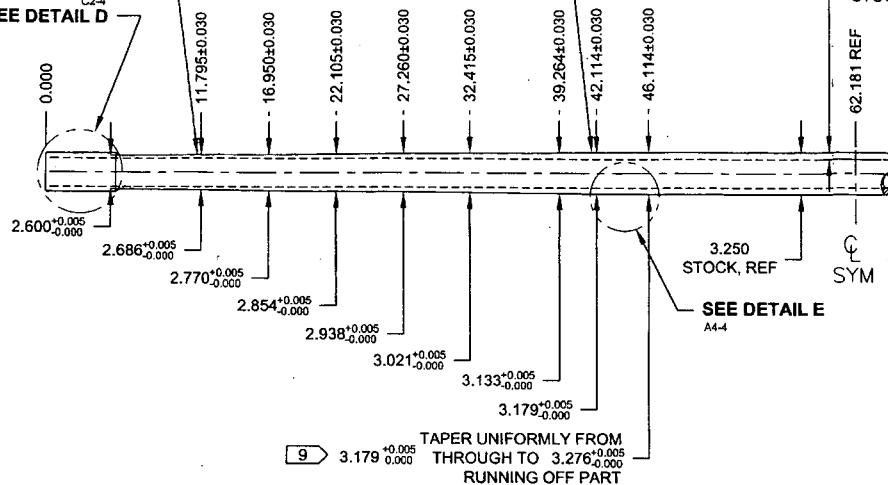


SEE DETAIL E

30° X 0.500 DEEP
CHAMFER

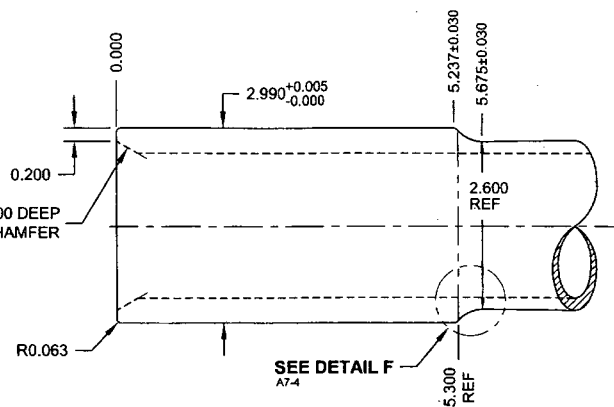


DETAIL D:
CROSSTUBE CUFF D8-4
SCALE 5X

D212-664-241TRN
TURNING DETAIL

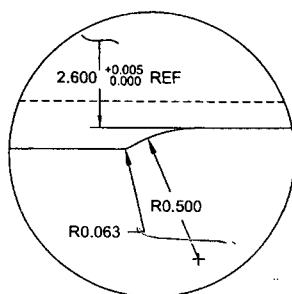

DETAIL F:
CUFF TRANSITION C2-4
SCALE 10X

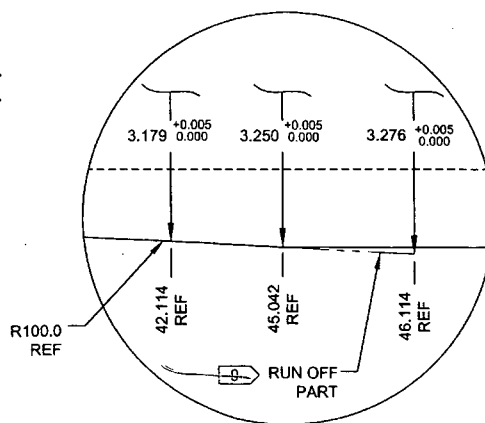

DETAIL E:
TAPER RUN-OFF C5-4
NOT TO SCALE

200811-614
11.07.28

UNDER REVIEW

DEO ATTACHED

RELEASED
2009-10-29

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	GP	DRAWING NO.	REV. D
MFG. APPR.	DS	D212-664-241	SHEET 4 OF 4
APPROVED	10	TITLE	SCALE
DE APPR.	11	CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

DRAWING NO. D212-664-241	TITLE CROSSTUBE ASSY (205/212 HI AFT)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-241-D-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN	CHECKED	MFG. APPR.	APPROVED	DE APPR.			
DATE 11.04.07	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12	DATE 11.04.12			

PURPOSE:

ADD AN INSPECTION WINDOW TO UNDERSIDE OF CROSSTUBE.

CHANGE:

NOTES 2 OF SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA) AND
PAINT OUTSIDE PER DART QSI 005 4.2
REMOVE MASKING AND APPLY CLEAR COAT

WAS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2

RELEASED
2011-04-18

UNDER REVIEW

11.06.13


BCN11-614

11.07.20

DRAWING NO. D212-664-241	TITLE CROSSTUBE ASSY (205/212 HI AFT)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-241-D-1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN	CHECKED <i>UP</i>	MFG. APPR. <i>E</i>	APPROVED <i>MD</i>		DE APPR. <i>MD</i>		
DATE 11.04.07	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12		DATE 11.04.12		


IS:

WAS:

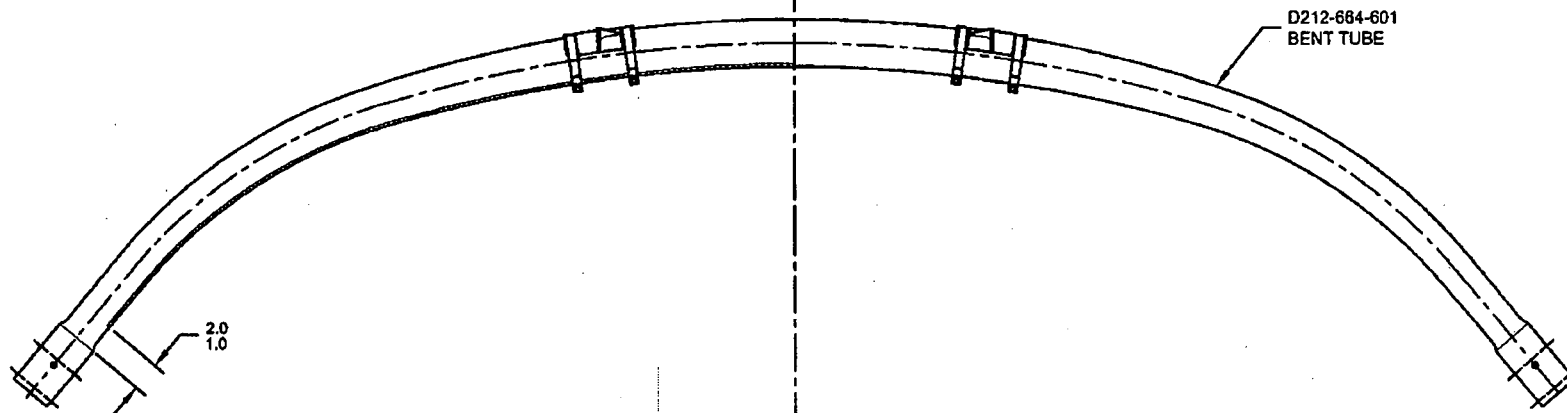

**D212-664-241/-241B
ASSEMBLY DETAIL**

MASK AREA PRIOR TO PAINTING,
REMOVE MASKING AFTER PAINT
AND APPLY CLEAR COAT

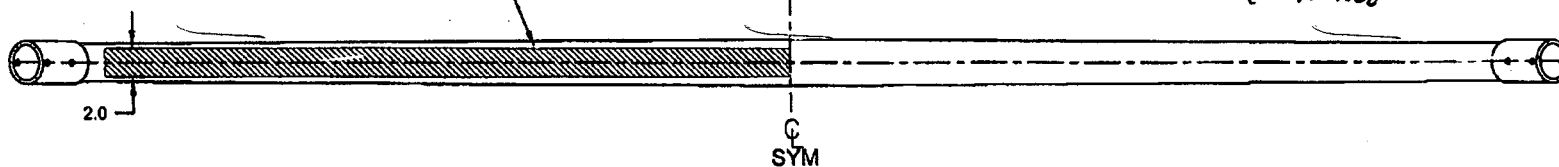

RELEASED
2011-04-18
MD

UNDER REVIEW

UP 11.06.13
D212-664-241
11.07.28

DRAWING NO. D212-664-241	TITLE CROSSTUBE ASS'Y (205/212 HI AFT)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-241-D-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>q2</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>8</i>	APPROVED <i>MP</i>	DE APPR. <i>#</i>			
DATE 11.07.15	DATE 11.07.20	DATE 11.07.21	DATE 11.07.21	DATE 11.07.21			

PURPOSE:

REPLACE MAGNOBOND WITH PROSEAL.

CHANGE:

IS:

Item	Qty -241	Qty -241B	Part Number	Description
7	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

WAS:

7	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	-----	----------------	---

NOTE 12 & 15, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) TO INSTALL D2940-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.**

WAS:

- 12) INSTALL D2940-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2940-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2011-07-28
W



5.0 PARTS LIST

5.1 HIGH GEAR CROSSTUBES

Item	-101	-201	-203	Part Number	Description
	X			D212-664-101	CROSSTUBE INSTALLATION, 204/205/210/212/214/412, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH FWD
		X		D212-664-201	CROSSTUBE INSTALLATION, 204/205/210/212/214, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH AFT
			X	D412-664-203	CROSSTUBE INSTALLATION, 412 HIGH AFT
1	1			D212-664-141	CROSSTUBE ASSEMBLY, 204/205/210/212/214/412, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH FWD
2		1		D212-664-241	CROSSTUBE ASSEMBLY, 204/205/210/212/214, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH AFT
3			1	D412-664-243	CROSSTUBE ASSEMBLY, 412 HIGH AFT
10	2			* D2893-1	SUPPORT
11	4			* D3595-063-450	RUBBER CUSHION
12	4			* MS21920-25	CLAMP (OR MS21042-26)
13	4			AN6-35A	BOLT
14	4			AN6-36A	BOLT
15	6			MS21042L6	NUT (OR MS21042-6)
16	18			AN960JD616	WASHER
20		2		* D2940-1	SUPPORT
21		4		* D3595-063-530	RUBBER CUSHION
22		4		* MS21920-28	CLAMP (OR MS21042-30)
23		4		AN6-40A	BOLT
24		2		AN6-41A	BOLT
25		6		MS21042L6	NUT (OR MS21042-6)
26		18		AN960JD616	WASHER
30			1	* D2896-1	SUPPORT
31			2	* D2856-600-1009	ABRASION STRIP
32			2	* D3595-063-570	RUBBER CUSHION
33			4	* MS21920-28	CLAMP
34			2	* MS21920-30	CLAMP (OR MS21042-32)
35			4	AN6-40A	BOLT
36			2	AN6-41A	BOLT
37			6	MS21042L6	NUT (OR MS21042-6)
38			18	AN960JD616	WASHER
39			2	* D3189-1	CHAFING SHIELD
50	1	1		D3428-1	PLACARD

*REFERENCE ONLY. PARTS ARE INCLUDED IN D212-664-141/241 OR D412-664-243 ASSEMBLIES ABOVE
 NOTE: KITS INCLUDE EXTRA HARDWARE FOR COMPATIBILITY WITH BOTH DART AND BELL/AA
 SKIDTUBES.



LIQUID PENETRANT TEST REPORT

P- 05634

CLIENT DART AEROSPACE DATE OCT-14-2011 TIME AM ☒ PM ☐
ATTENTION LYNDA / CHANTAL / VAN / MART ACUREN JOB NO. 188-11-02196
ADDRESS 1270, ABERDEEN ST. PO/VO NO. 151571
HAWKESBURY, ON WORK LOCATION AS ADDRESS
PROJECT PT -> WET FLUORESCENT LIQUID PENETRANT ON 'CROSSTUBES' ACCEPTANCE STD. ASTM A7/CST 038 REV./DATE 2005
ITEM(S) EXAMINED - SEE BELOW -

JOB DESCRIPTION PROCEDURE NO. LT-002 REV./DATE 2007 TECHNIQUE NO. LT-002 REV./DATE 2007
PART NO. MATERIAL Aluminum THICKNESS
SCOPE PERFORMED A WET FLUORESCENT LIQUID PENETRANT INSPECTION ON 100% OF THE EXTERNAL SURFACE ON ITEMS MENTIONED BELOW

TEST DETAILS
METHOD ☒ FLUORESCENT ☐ VISIBLE ☒ WATER WASH ☐ SOLVENT REMOVABLE ☐ POST EMULSIFIED
FAMILY BRAND MAGNAFLUX BLACK LIGHT S/N 13798 OUTPUT > 1000 μ W/cm² ☐ AMBIENT < 2 fc
PENETRANT ZL-67 MINIMUM DWELL TIME 10 MIN. LIGHTING EQUIP. ☐ FLASHLIGHT ☐ TROUBLELIGHT ☐ OUTPUT > 100 fc @ SURFACE
PENETRANT REMOVER H₂O MINIMUM DRY TIME > 10 MIN. OTHER
DEVELOPER SKD-32 MINIMUM DWELL TIME 10 MIN. LIGHT METER S/N CAL DUE DATE Aug-2011
DEVELOPER TYPE ☒ NON AQUEOUS ☐ AQUEOUS ☐ DRY

TEST SURFACE
SURFACE CONDITION ☐ AS GROUND ☐ AS WELDED ☐ MACHINED ☐ SHOT BLASTED ☒ CLEAN BARE METAL
SURFACE TEMPERATURE ☐ < - 4°C/ 20°F ☐ - 4°C/ 20°F TO 10°C/ 50°F ☒ 10°C/ 50°F TO 52°C/ 125°F ☐ > 52°C/ 125°F

RESULTS- (☐ METRIC ☐ IMPERIAL)

ITEM ID	DESCRIPTION	STATUS
1	CROSSTUBE W.O ID 72417	✓
2	72418	✓
3	73642	✓
4	73690	✓
5	73691	✓
6	74330	✓
7	74686	✓
8	74687	✓

NO RELEVANT INDICATION WAS DETECTED AS PER APPLICABLE STANDARDS.

ITEM ID D212-664-201 AFT
D212-664-201 AFT
D212-664-101 FWD
D412-664-203 AFT
D412-664-203 AFT
D412-664-101 FWD
D407-667-105 FWD
D407-667-105 FWD

11-10-17

Scope of Services

The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner/operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner/operator and the owner/operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.

Standard of Care

In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

SIGNATURES

CLIENT REPRESENTATIVE John T. Hey DTR # E 44763
TECHNICIAN (SIGNATURE): James Desrochers REPORT REVIEWED BY:
NAME (PRINT): James Desrochers NAME INITIALS
CGSB LEVEL 2 SNT LEVEL 3049 CGSB LEVEL SNT LEVEL
CGSB REG. NO. CGSB REG. NO.